N8116-84(SAS-expander Card)

Notes on Firmware Updating

When updating firmware from this Starter Pack(Ver S8.10-010.05) by offline mode, N8116-84 SAS Expander firmware cannot update.
Please update by following because it can update by online mode.

[Target products and target version]
 Products:
- Products
     N8116-84 SAS-expander Card
- Firmware version
     5.14

[Target System]
 Express5800/R120h-2E
 Express5800/R120h-2E(2nd-Gen)
 Express5800/R120h-2E(3rd-Gen)

[How to confirm the SAS Expander Firmware version]
 Confirm the firmware version by either of the following procedures:
 < System Utilities >
 1) Startup System Utilities by pressing the F9 key during POST.
 2) Select System Configuration.
 3) Select the Embedded RAID.
 4) Select Disk Utilities
 5) Select HPE 12G SAS Exp Card
 6) Select Device Information and check the firmware version

 < iLO web interface >
 1) Connect to the target Server via iLO web interface and log in.
 2) Select [Firmware & OS Software] -> [Installed Firmware].
 3) Confirm the [Firmware Name] and [Firmware Version] of the SAS Expander Card.
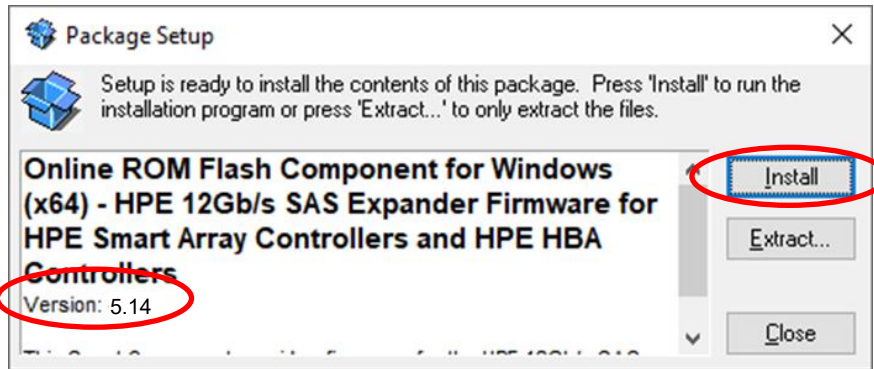   The [Firmware Name] for the SAS Expander Card is displayed as "Drive Enclosure"

[Firmware update procedure]

 [Windows]

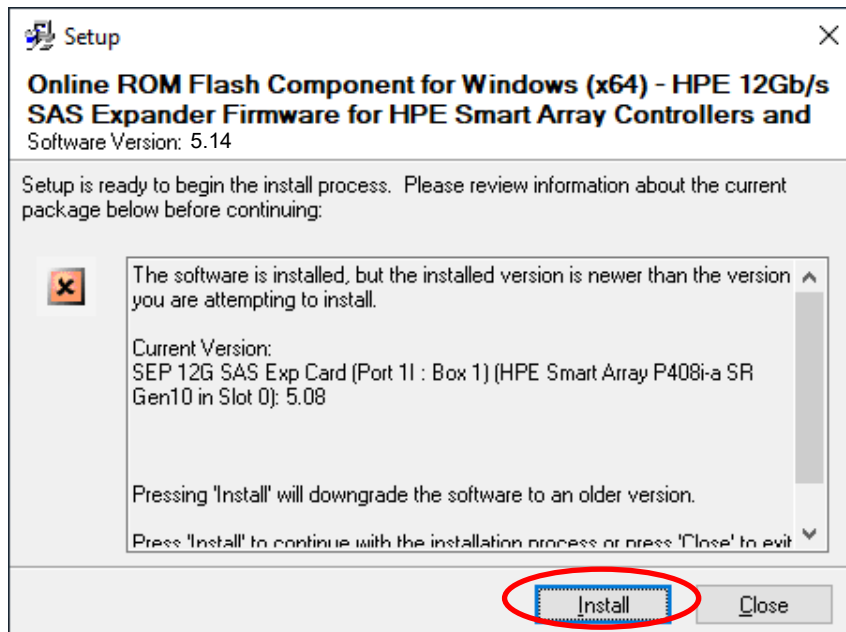   Firmware module : cp053176.exe

   (1) Move to packages directory in S8.10-010.05.

   (2) Double-Click the firmware module.

   (3) After [Package setup] window is displayed, check the version(5.14) and click
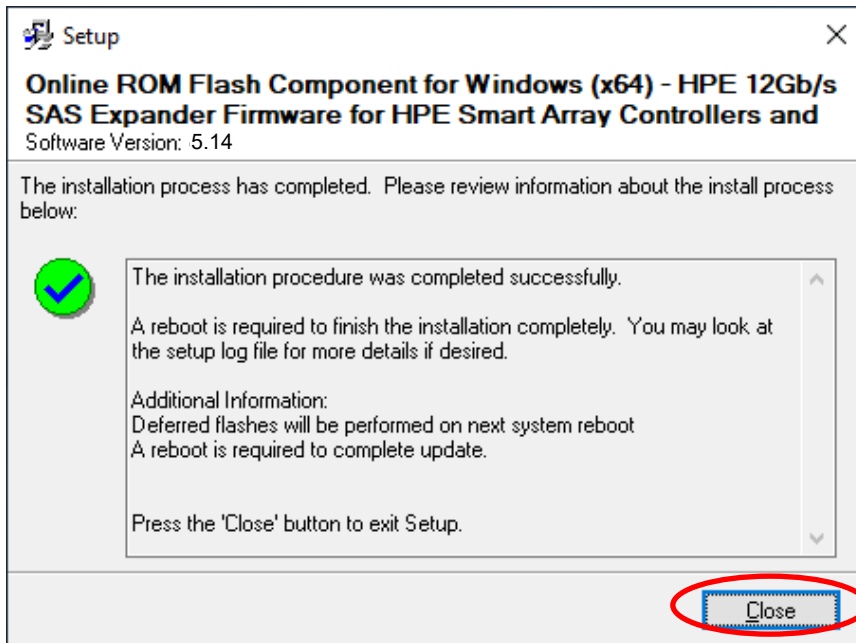   **Install**.

   (4) After the following message is displayed, click **Install**.
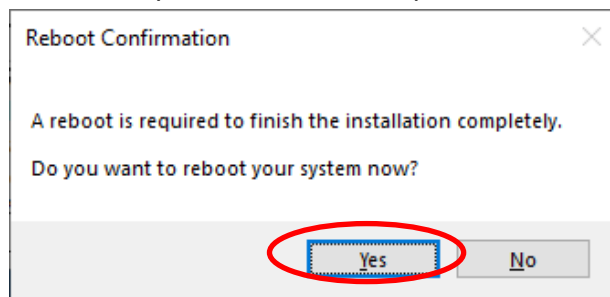

   (5) Install process proceeds.It will take several minutes to complete.

(6) After the following message is displayed, click **Close**.

(7) After the system reboot is requested, click **Yes** and reboot the server.

(8) Refer to [How to confirm the SAS Expander Firmware version] and confirm the [Firmware Version] is "5.14"

Now, the firmware update is complete.